Release Date: November 21, 2019

### **VRMF Level Data Results:**

VRMF level From:	88.54.31.0
VRMF Level To:	88.54.37.0
Report for:	All DS8880

### **Code Bundle Contents**

DS8880 Code Bundle Level	SEA or LMC Version:	DSCLI Client	Heat Map Transfer Utility	Storage Manager	Copy Services Manager
88.54.37.0	7.8.54.91	7.8.54.77	7.8.54.77	5.8.54.1041	6.2.6

Overview of new features and functions supported by this release

### At a glance:

Code fixes

# This new microcode release supports DS8880 systems only.

### **Select Modifications Included in this Release Note:**

This is a list of some modifications contained across one or more LIC (License Internal Code) or microcode release(s). The potential impact is variable. Specific environments may aggravate or degrade the potential impact. Problem(s) fixed and reported in this release note may not be in higher levels of code bundles.

### **Definition of Problem Severity:**

1	High Impact	<ul><li>Acute: Irrecoverable error with potential loss of data.</li><li>Serious: Irrecoverable error with potential loss of access to data, or critical function.</li></ul>	
2	Moderate		
3	Service		
4	Improvements		

**HIPER:** High Impact problem that is Pervasive: 3 or more occurrences

## Acute: An irrecoverable error with potential loss of data.

### Data miscompare on SafeGuarded Copy recovery volume

- 1. **Problem Description:** Track Bitmap and Recovery Bitmap were out of sync during a host write to the recovery volume. This caused inconsistent data on the recovery volume, making it unusable.
- 2. Potential Impact of Problem: Data miscompare

3. Problem Severity: High Impact

4. Pervasive Problem: No

ID# 346873

# Serious: An irrecoverable error with potential loss of access to data, or critical function.

#### HIPER Start Secondary fails with MTIR

- 1. **Problem Description:** Unintentional Multi-Target Incremental Resync pairs can be created that point to themselves. Exposure exists in systems running on R8.5 bundles. Can cause HyperSwap failure. Removal of these pair relations requires warmstart.
- 2. Potential Impact of Problem: HyperSwap failure
- Problem Severity: HIPER
  Pervasive Problem: Yes

ID# 345590

### HIPER Unable to IPL from SafeGuarded Copy recovery volume

- 1. **Problem Description:** When using a Task Control Block with two Cache Track Requests to read a track on the recovery volume, the second access may be discarded.
- 2. Potential Impact of Problem: IPL failure
- Problem Severity: HIPER
  Pervasive Problem: Yes

ID# 346511

# Moderate: A system path is not operational and/or performance may be degraded.

#### Preserve Mirror FlashCopy suspend

- **1. Problem Description:** PMFLC suspended because of a Track Format Descriptor mismatch on the target. Systems running 88.54.31.0 are exposed.
- 2. Potential Impact of Problem: PMFLC suspend.
- Problem Severity: Moderate
  Pervasive Problem: Yes

ID# 346053

## Service: A recoverable error, Service improvements.

### ODD dump failed to complete

- 1. **Problem Description:** Cache Directory Control Block lock contention while processing an ODD Dump. The ODD dump being processed was not completed.
- 2. Potential Impact of Problem: ODD Dump failure.

3. Problem Severity: Service4. Pervasive Problem: No

ID# 341027

### **HMC services slow to respond**

1. Problem Description: ESSNI threads consuming 100% CPU on HMCs running 88.54.31.0.

2. Potential Impact of Problem: HMC unresponsive

Problem Severity: Service
 Pervasive Problem: No

ID# 343933

### FlashCopy onto GM returns incorrect status

1. **Problem Description:** Attempt to establish an unsupported Flash Copy relation onto Global Mirror failed as expected, but the operation reported good status.

2. Potential Impact of Problem: Incorrect status

3. Problem Severity: Service4. Pervasive Problem: No

ID# 345867

### Improvements: Improvements for better usability

None.

#### **Trademarks**

The following terms are trademarks of the International Business Machines Corporation in the United States, other countries, or both.

- > AIX
- > Enterprise Storage Server
- > ESCON
- > FICON
- > i5/OS
- > iSeries
- > IBM
- > pSeries
- > S/390
- > System Storage
- > TotalStorage
- > z/OS
- > zSeries

IBM, the IBM logo, and ibm.com are trademarks or registered trademarks of International Business Machines Corp., registered in many jurisdictions worldwide. Other product and service names might be trademarks of IBM or other companies. A current list of IBM trademarks is available on the web at Copyright and trademark information at http://www.ibm.com/legal/us/en/copytrade.shtml. Adobe, the Adobe logo, PostScript, and the PostScript logo are either registered trademarks or trademarks of Adobe Systems Incorporated in the United States, and/or other countries.

Java and all Java-based trademarks and logos are trademarks or registered trademarks of Oracle and/or its affiliates.

Linux is a trademark of Linus Torvalds in the United States, other countries, or both.

Microsoft, Windows, and Windows NT are trademarks of Microsoft Corporation in the United States, other countries, or both.

© Copyright IBM Corp. 2004, 2011

### **Notices**

This information was developed for products and services offered in the U.S.A. IBM may not offer the products, services, or features discussed in this document in other countries. Consult your local IBM representative for information on the products and services currently available in your area. Any reference to an IBM product, program, or service is not intended to state or imply that only that IBM product, program, or service may be used. Any functionally equivalent product, program, or service that does not infringe any IBM intellectual property right may be used instead. However, it is the user's responsibility to evaluate and verify the operation of any non-IBM product, program, or service.

IBM may have patents or pending patent applications covering subject matter described in this document. The furnishing of this document does not give you any license to these patents. You can send license inquiries, in writing, to:

IBM Director of Licensing

IBM Corporation North Castle Drive

Armonk, NY 10504-1785

U.S.A.

The following paragraph does not apply to the United Kingdom or any other country where such provisions are inconsistent with local law: INTERNATIONAL BUSINESS MACHINES CORPORATION PROVIDES THIS PUBLICATIONS "AS IS" WITHOUT WARRANTY OF ANY KIND, EITHER EXPRESS OR IMPLIED, INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTIES OF NON-INFRINGEMENT, MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. Some states do not allow disclaimer of express or implied warranties in certain transactions, therefore, this statement may not apply to you.

This information could include technical inaccuracies or typographical errors. Changes are periodically made to the information herein; these changes will be incorporated in new editions of the publication. IBM may make improvements and/or changes in the product(s) and/or the program(s) described in this publication at any time without notice.